

Accessibility Survey



Transportation Depot Center

8150 Nance Avenue
Downey, CA 90240

Date of Inspection
10/22/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Transportation Depot Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk From Downey Avenue

Change In Level

Path Of Travel , Walking Surfaces : Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Provide smooth surface \$150



Code Reference ADA 303, 403.4, 303.2, CA 11B-303, CA 11B-403.4

Notes : Cross slope greater than 2% continues for 360 feet.

Progress

Record Number	287710	Resolution	None
Progress	In_Progress	Priority	One
Actual Date		Projected Date	12/31/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Doors - Main Office : Door , Hardware

Main Entrance

Push Bar / D Handle

Door , Hardware : Door Opening Pressure

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 15.00 pounds


Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

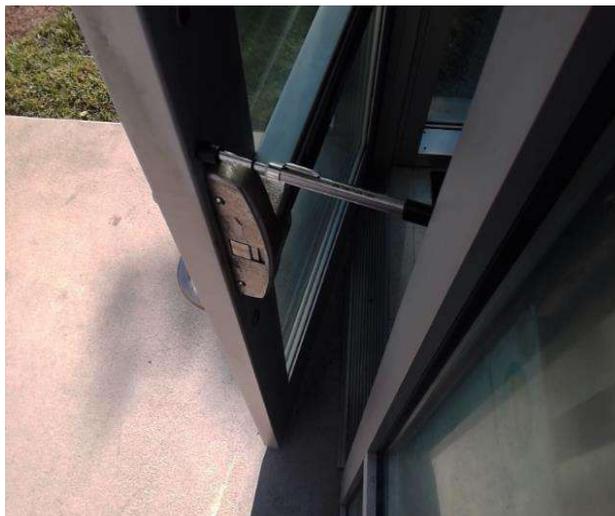

Code Reference ADA 404.2.9,CA 11B-404.2.9

Progress

Record Number	287705	Resolution	None
Progress	In_Progress	Priority	Two
Actual Date		Projected Date	12/31/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Doors - Main Office : Door , Hardware

Unisex Restroom

Lever

Door , Hardware : Door Opening Pressure

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 12.00 pounds


Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

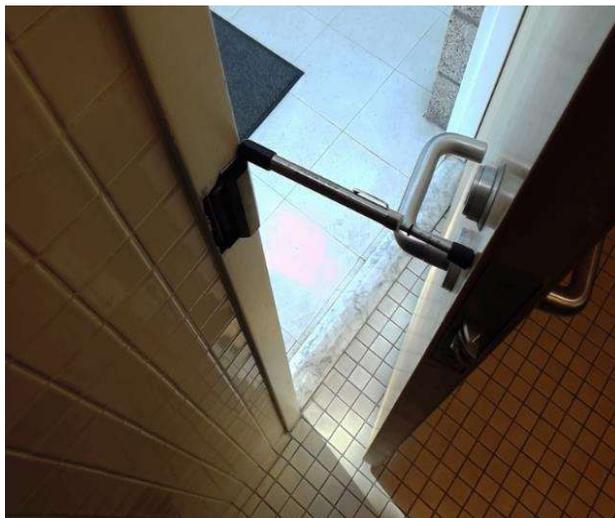

Code Reference ADA 404.2.9,CA 11B-404.2.9

Progress

Record Number	287723	Resolution	None
Progress	In_Progress	Priority	Two
Actual Date		Projected Date	12/31/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Lavatory

Unisex Restroom

Lavatory

Restroom , Lavatory : Lavatory - Supply Lines not wrapped

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149



Code Reference ADA 213, 606, 606.5,CA 11B-606.5

Progress

Record Number	287717	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone Next To Main Buiding

Passenger Loading Zone : No Access Aisle

Finding

There is no required striped access aisle adjacent to the passenger loading zone.

On-Site Finding None Found

Recommendation

Create an access aisle to meet the required minimum width and length adjacent and parallel to the vehicle pull-up space. The access aisle striping for the passenger loading zone shall provide immediate access to an adjacent curb ramp or primary path of travel.

Recommendation See Recommendation

Costing Info (Estimated)

Stripe vehicle space and install sign \$650



Code Reference ADA 502, 503, 503.3, CA 11B-503.3

Progress

Record Number	287698	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone Next To Main Buiding

Passenger Loading Zone : No Sign

Finding

Passenger loading zone has no sign.

On-Site Finding Not Marked

Recommendation

Mark the passenger loading zone with ISA symbol of accessibility.

Recommendation See Recommendation

Costing Info (Estimated)

Mark access aisle \$220



Code Reference

ADA 503.3.3,CA 11B-703.5,CA 11B-703.7.2.1,CA 11B-503.6

Progress

Record Number	287699	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Path of Travel - Main Office : Path Of Travel , Walking Surfaces

Lobby

Floor Mat

Path Of Travel , Walking Surfaces : Mat or Runner

Finding

The mats or carpet runners do not adhere to the underlying floor surface and slip, thereby creating a hazardous path of travel.

On-Site Finding Not Accessible

Recommendation

Securely fasten the mats or carpet runners or replace with a mat or carpet runner that grips to the underlying floor surface to provide a firm, stable, continuous and relatively smooth path of travel surface. Mats or carpet runners along the primary path of travel shall provide beveled edges on all sides to prevent roll over.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat or carpet runner \$84
that grips to the underlying
floor surface



Code Reference ADA 302, 302.2,CA 11B-403.2,CA 11B-302

Progress

Record Number	287720	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Doors - Main Office : Door , Clear Floor Space

Main Entrance

Push Side

Door , Clear Floor Space : Floor Mat

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant


Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor surface \$126

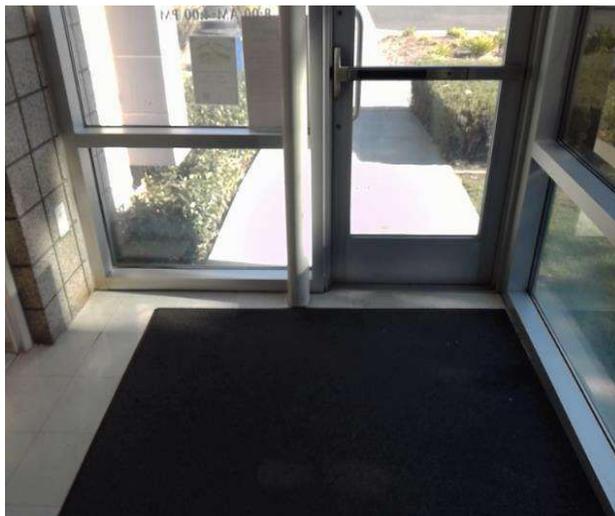

Code Reference ADA 403.2, 302.1,CA 11B-302.1,CA 11B-403.2

Notes : Pole obstructs latch side clearance.

Progress

Record Number	287707	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Signage - Exterior : Signage , Signage

Directional Signage From The Public Right Of Way

Signage , Signage : No Directional or Information Signage

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158



Code Reference ADA 703, 216, 216.3, CA 11B-216.3, 703.5, CA 11B-703.5

Progress

Record Number	287695	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Signage - Main Office : Signage , Signage

Main Entrance

Signage , Signage : No Accessible Element/Entrance Signage

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158



Code Reference ADA 216.2, 216.6, CA 11B-216.2, CA 11B-216.6

Progress

Record Number	287704	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Dispensers

Unisex Restroom

Blower

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 44.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277



Code Reference ADA 309, 205, 308, 606, 308.1, CA 11B-603.5

Progress

Record Number	287716	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Door Signage

Unisex Restroom

Door Sign - Unisex

Restroom , Door Signage : Door Signage Height

Finding

The gender use signage on the entrance door is not mounted at the required height.

On-Site Finding 61.00 inches

Recommendation

Post gender use signage on the center of the door at the required height.

Recommendation 58.00 - 60.00 inches

Costing Info (Estimated)

Install signage \$158



Code Reference CA 11B-703.7.2.6

Progress

Record Number	287718	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Dispensers

Unisex Restroom

Soap

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 44.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 40.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277



Code Reference ADA 309, 205, 308, 606, 308.1, CA 11B-603.5

Progress

Record Number	287715	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Reach Ranges - Main Office : Reach Range , Element Highest Point of Operation

Lobby

Bus Route Maps - Other

Reach Range , Element Highest Point of Operation : Element Highest Point of Operation

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 65.00 inches


Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 15.00 - 48.00 inches

Costing Info (Estimated)

Readjust element height \$50

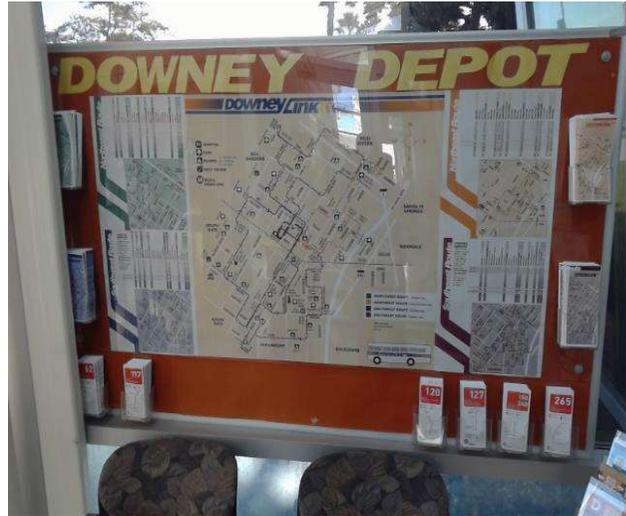

Code Reference ADA 309, 304, 308, 902.4.2, CA 11B-308, CA 11B-902.4.2

Progress

Record Number	287703	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Toilet

Unisex Restroom

Restroom , Toilet : Toilet Minimum Distance From Any fixture

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 36.50 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500



Code Reference ADA 603, 604.2, CA 11B-604.2

Progress

Record Number	287725	Resolution	None
Progress	Not_Started	Priority	Four
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Toilet Compartment

Unisex Restroom

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 12.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277



Code Reference ADA 603, 604.7,CA 11B-604.7,CA 11B-309.4

Progress

Record Number	287729	Resolution	None
Progress	Not_Started	Priority	Four
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom

Unisex Restroom

Restroom : No Door Privacy Lock and Occupied Indicator

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever handled lock set \$804



Code Reference ADA 213, 213.2.1,CA 11B-213.2.1

Progress

Record Number	287714	Resolution	None
Progress	Not_Started	Priority	Four
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone Next To Main Buiding

Passenger Loading Zone : Curbs Between Access Aisle and Vehicle Pull-up Space

Finding

There are curbs between the access aisle and the vehicle pull-up space.

On-Site Finding Curbs Exists

Recommendation

Remove curbs or install compliant curb ramp to provide accessible path of travel from the vehicle pull-up space and the access aisle.

Recommendation See Recommendation

Costing Info (Estimated)

Cut opening through island \$150



Code Reference ADA 502, 503, 503.4,CA 11B-503.4,CA 11B-206.2.1,CA 11B-303.4

Progress

Record Number	287697	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Curb Ramps - Exterior : Curb Ramp

1st Curb Ramp From The Bus Stops To Main Entrance

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

Record Number	287712	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Curb Ramps - Exterior : Curb Ramp

2nd Curb Ramp From The Bus Stops To Main Entrance

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

Record Number	287700	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

2nd Curb Ramp From The Bus Stops To Main Entrance

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

Record Number	287701	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

2nd Curb Ramp From The Bus Stops To Main Entrance

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

Record Number	287702	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Sidewalk From Bus Stop To Main Building

Vehicular Traffic

Path Of Travel , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding None Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	287722	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk From Bus Stop To Main Building

Exterior Walkway

Path Of Travel , Walking Surfaces : Walking Surface Cross Slope

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.50 percent for 20.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install pathway \$3,600



Code Reference ADA 402, 403.3,CA 11B-403.3

Progress

Record Number	287721	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Path of Travel - Exterior : Path Of Travel , Vehicular Traffic

Sidewalk From Downey Avenue

Bus Stop Platform

Path Of Travel , Vehicular Traffic : Detectable Warning Domes Direction

Finding

Detectable warning domes are not aligned in the direction of travel.

On-Site Finding Not Complaint

Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

Costing Info (Estimated)

\$24



Code Reference

Notes : The truncated dome strip is damaged and should be repaired.

Progress

Record Number	287711	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk From Downey Avenue

Exterior Walkway

Path Of Travel , Walking Surfaces : Walking Surface Cross Slope

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.50 percent

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install pathway \$3,600



Code Reference ADA 402, 403.3, CA 11B-403.3

Notes : Cross slope greater than 2% continues for 360 feet.

Progress

Record Number	287709	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk From Passenger Loading Zone To Main Entrance

Exterior Walkway

Path Of Travel , Walking Surfaces : Walking Surface Slope

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 6.30 percent for 20.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Install pathway \$3,600



Code Reference ADA 402, 403.3,CA 11B-403.3,CA 11B-402

Progress

Record Number	287696	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk Next To Passenger Loading Zone

Exterior Walkway

Path Of Travel , Walking Surfaces : Walking Surface Cross Slope

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 2.70 percent for 10.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install pathway \$3,600



Code Reference ADA 402, 403.3,CA 11B-403.3

Progress

Record Number	287719	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Doors - Main Office : Door , Clear Floor Space

Main Entrance

Pull Side

Door , Clear Floor Space : Floor Surface Slope

Finding

There is no level landing at this door.

On-Site Finding 2.70 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500



Code Reference ADA 302, 404, 305, 404.2.4.4, CA 11B-404.2.4.4

Progress

Record Number	287708	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2030
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Doors - Main Office : Door , Latch Side Clearance

Main Entrance

Push Side

Door , Latch Side Clearance : Front Approach Latch Side Clearance

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921



Code Reference ADA 404, 404.2.4, CA 11B-404.2.4.1

Notes : Pole obstructs latch side clearance.

Progress

Record Number	287706	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2030
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Doors - Main Office : Door , Threshold

Unisex Restroom

Door , Threshold : Door Threshold

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.87 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436



Code Reference ADA 404, 404.2.5, CA 11B-404.2.5

Progress

Record Number	287724	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Grab Bars

Unisex Restroom

Restroom , Grab Bars : Distance from Back Wall to Front of Grab Bar

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 46.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267



Code Reference ADA 603, 609, 604.5.1,CA 11B-604.5.1,CA 11B-609

Progress

Record Number	287726	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2035
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center

Restrooms - Main Office : Restroom , Grab Bars

Unisex Restroom

Restroom , Grab Bars : Distance from Front Edge of Toilet to Front of Grab Bar

Finding

The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.

On-Site Finding 19.50 inches

Recommendation

Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.

Recommendation At least 24.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267



Code Reference CA 11B-604.5.1

Progress

Record Number	287727	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2035
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Transportation Depot Center



Transportation Depot Center

8150 Nance Avenue
Downey, CA 90240

Date of Inspection
10/22/2016

***Estimated Facility Total: \$28,239**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

